




CONTINUOUS ROTATION

7

RELAYS

PC


- 40 contact points
- Contacts rated 1.5A at 120 VAC
- Standard/stock AC voltage 120
- Weight 17 oz. (431.8 grams)

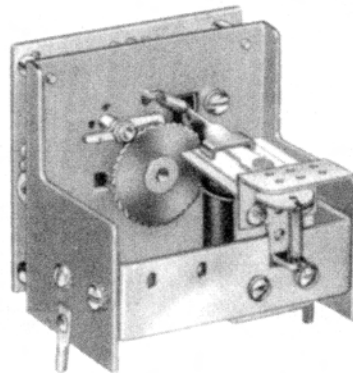

Coil Voltage	OHMS Stepping Coil	No. of Points	No. of Active Points	Max Steps Per Sec.	PART NUMBERS
120VAC	102	40	40	20	PC-40-120A

705

- 12 contact points
- Contacts rated 3 amps at 120 VAC
- Standard/stock DC voltages 12 & 24
- Weight 5 oz. (127 grams)

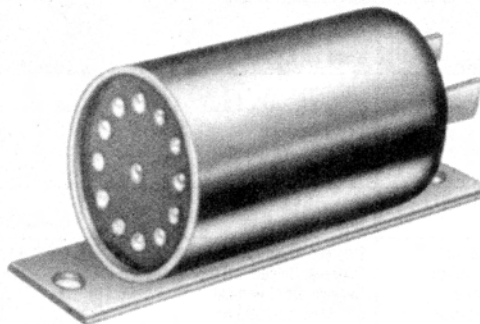


Coil Voltage	Coil Res. Ω	No. of Points	PART NUMBERS
12VDC	16	12	705-12P-12D
24VDC	24	12	705-12P-24D

ADD and SUBTRACT

PAS

- Wiper moves either direction depending on which coil is energized
- 40 contact points
- Contacts rated 1.5 amps at 120 VAC
- Standard/stock AC voltage 120
- Weight 22 oz. (431.8 grams)

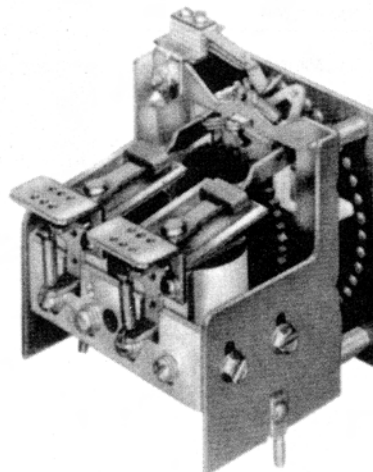

Coil Voltage	OHMS Stepping Coil	No. of Points	No. of Active Points	Max Steps Per Sec.	PART NUMBERS
120VAC	70	40	40	20	PAS-120A