MODEL 2780

AC Current Transducer

- High accuracy, low cost
- Isolated input and output
- Socket-mounted, solid-state design
- 0 10VDC Output
- Five year unconditional warranty

DESCRIPTION


The **Model 2780 AC Current Transducer** is designed to accept an AC current input, and provide a proportional DC voltage output. A linear transformer input is coupled to a solid-state output amplifier. The Model 2780 is powered by a 115VAC or 230VAC source, and is socket-mounted for ease of use.

Model 2780 Current Transducers can be used with computer and programmable controls to provide:

- Motor and power control
- Supervisory data acquisition
- Load monitoring
- Feedback control
- Energy management

DIMENSIONS

Fax:

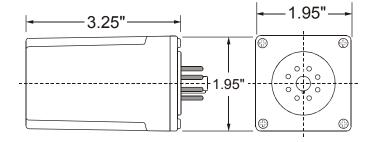





SPECIFICATIONS

MODEL	2780-115	2780-230
Supply voltage	115VAC @ 50/60Hz	230VAC @ 50/60Hz
Input current	0-5 amps	
Input frequencies	25-400Hz	
Input burden	0.5VA at 120VAC 60Hz	
Output @ rated input	0 - 10VDC	
Maximum load	500 ohms	
Output accuracy	2% at 77°F	
Output ripple	1% max at nominal frequency	
Response time	800ms from 0-99%	
Overload withstand	2 times rated output-continuous 10 times rated input-1 second	
Dielectric withstand voltage (isolation)	1500 VRMS input, output, case	
Operating temperature	-20° to +131°F	
Humidity tolerance	0-97% w/o condensation	
Enclosure material	ABS plastic	
Mounting	8-pin socket (*order separately)	
Weight	9.5 oz.	
Agency Approvals	UL Recognized-US/Canada	

*Order 8-pin socket number 51X120

Telephone: Main - (918) 438-1220

Sales - (800) 862-2875 (918) 437-7584

E-mail: sales@time-mark.com http://www.time-mark.com



11440 East Pine Street Tulsa, Oklahoma 74116 11/2011

© 2011 TIME MARK CORPORATION



MODEL 2780 AC Current Transducer

READ ALL INSTRUCTIONS BEFORE INSTALLING, OPERATING OR SERVICING THIS DEVICE. KEEP THIS DATA SHEET FOR FUTURE REFERENCE.

GENERAL SAFETY

POTENTIALLY HAZARDOUS VOLTAGES ARE PRESENT AT THE TERMINALS OF THE MODEL 2780. ALL ELECTRICAL POWER SHOULD BE REMOVED WHEN CONNECTING OR DISCONNECTING WIRING. THIS DEVICE SHOULD BE INSTALLED AND SERVICED BY QUALIFIED PERSONNEL.

Installation Instructions


INSTALLATION

The Model 2780 AC Current Transducer requires an 8 -pin mounting socket, such as the Time Mark Model 51X120.

The base connecting diagram on the unit shows the pin connection numbers for the AC power, the AC Current input, and the DC Voltage Out.


Connect the appropriate wiring to the socket as required (See the Typical Application diagram).

PIN DRAWING



NOTE: When installing the Model 2780 Transducer in areas of high humidity or contamination, it is recommended that the base area and all exposed metal parts of the socket be coated liberally with a good quality silicone grease, such as Dow Corning DC-4 or DC-4X. Insert the unit into the socket and wipe off excess grease around the base. This will prevent the entrance of moisture and other contaminates into the base and socket areas.

TYPICAL APPLICATION

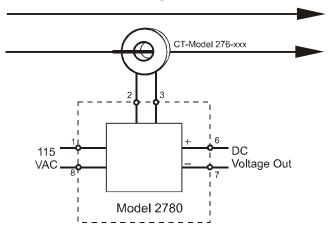

TROUBLESHOOTING

Should the Model 2780 AC Current Transducer fail to operate properly, check that all voltage is present, and is of the correct voltage level. Check all fuses and verify that all wiring connections are correct. problems persist, contact your local Time Mark Distributor, or the factory for assistance, Monday-Friday, 8 a.m. to 5 p.m. CST.

WARRANTY

This product is warranted to be free from defects in materials and workmanship, and is covered by our exclusive 5-year Unconditional Warranty. Should this device fail to operate for any reason, we will repair it for five years from the date of manufacture. For complete warranty details, see the Terms and Conditions of Sales page in the front section of the Time Mark catalog or contact Time Mark at 1-800-862-2875.

Telephone: Main -(918) 438-1220

Fax:

Sales -(800) 862-2875 (918) 437-7584

E-mail: sales@time-mark.com Internet: http://www.time-mark.com



11440 East Pine Street Tulsa, Oklahoma 74116 11/2011

© 2011 TIME MARK CORPORATION

